

COUGARS UNLIMITED LLC



2025A Catalog

Sequential Turn Signal Parts and Wiring for
Cougars, Thunderbirds, Shelby Mustangs,
and Custom Cars

COUGARS
UNLIMITED
LLC



6831 Truchas Dr. NE
Albuquerque, NM 87109
www.cougarsunlimited.net

Copyright © Cougars Unlimited LLC
Manufacturer of Electronic Sequencers since 1981
Not affiliated with the Ford Motor Company

Cougars Unlimited LLC
 6831 Truchas DR NE
 Albuquerque, NM 87109
 (505) 821-1002 9AM-4PM Mountain



Web Site:
www.cougarsunlimited.net

email: cougars_unlimited@thuntek.net

Cougars Unlimited manufactures replacement parts for the sequential turn signal systems found in Cougars, Thunderbirds, and Shelby Mustangs. These parts are designed to outlast and outperform the original parts provided by Ford.

These replacement parts provide the equivalent function of the OEM parts but with modern reliability. OEM style wiring harnesses, mounting brackets, and installation instructions are included with each part. A simple troubleshooting guide and typical vehicle schematic is included with each system unit. These parts are covered by a **two** year limited warranty and are designed and assembled in the USA.

We are *your* source for sequential turn signal parts for Mercury Cougars, Ford Thunderbirds, Shelby Mustangs, and Custom Cars.

QUICK INDEX GUIDE

Part Description	Cougar	Thunderbird	Shelby Mustang	Custom Car
New Products	3,4,5,6,7,8	3,4,5,6,7,8	3,4,5,6,7,8	4,5,6,7
Sequential Systems	3,6,11,17	3,6,12,17,18	3,6,13,14,17	17
Sequential Flashers	9	9		
Turn signal relay	5,10	5,10		
Stop lamp relay	11	11		
Emergency relay	11			
Flasher	15	15,16	15	15
Turn Signal Switches	20	20	20	
Wiring harnesses	21			
Price List	27	27	27	27
Sales and Return Policy	36	36	36	36

Turn Signal Troubleshooting Guides – 1967-68 factory manual on CD (in color), invaluable for diagnosing sequential turn signal problems.

1967-68 Cougar

TSG-CD


Copyright © Cougars Unlimited LLC
 Cougars Unlimited LLC, 6831 Truchas Dr. NE, Albuquerque, NM 87109
www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981
 Not affiliated with the Ford Motor Company

Sequential Turn Signal Controller

With Adjustable Delay between bulbs

for: 1969-1973 Cougars
1969-1971 Thunderbirds
1969-1970 Shelby Mustangs

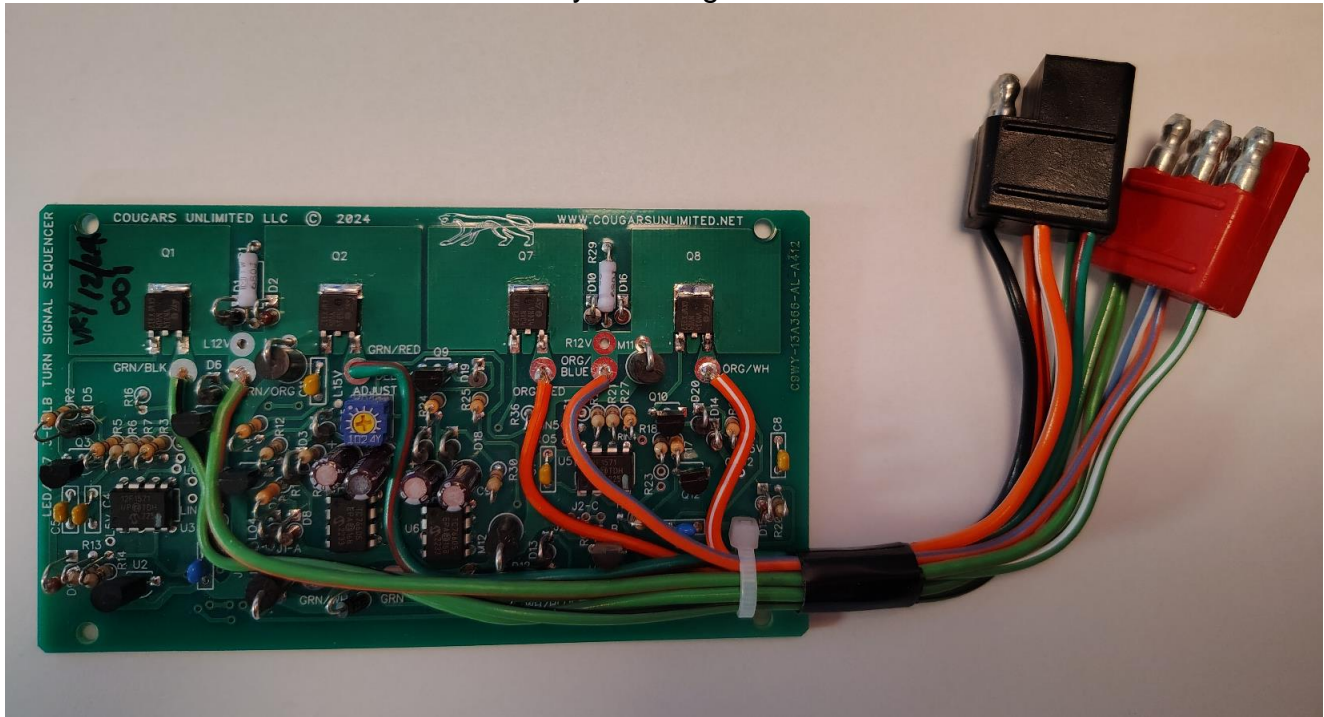

Easy to install, the C9WY-13A366-ADJ sequential controller includes:

- Replacement electronic sequencer ready to install in your OEM case
- Original style molded connectors, just plug it in!
- Installation guide with turn signal system diagrams and trouble-shooting hints

- * Works with “Plasma” LED, Tower LED, or incandescent tail light bulbs (not included)
- * Solid state, no relays to wear out!
- * Provides maximum light brightness

Two year warranty, Designed and built in the USA!

A D0WY-13350-AR or D0WY-13350-L Electronic flasher is required (not included).

1971 Cougars built from 2/1/71 - 5/15/71 must convert to taillight harness to red/black connectors using C9WY-13H366-AR pigtail kit.


When using front LED lights on 1970 & 1971 Cougars, an LED side marker adapter kit is required:

1970 Cougar	D0WY-15A434-LSM
1971 Cougar	D1WY-15A434-LSM

Makers of Cougar and Thunderbird Electronic Sequencers since 1981

Turn Signal “Switch Saver” for 1967-73 Cougars and 1967-71 Thunderbirds

Cougars Unlimited LLC announces *the* solution for failure-prone turn signal switches in 1967-73 Cougars and 1967-71 Thunderbirds – **The Switch Saver™**.

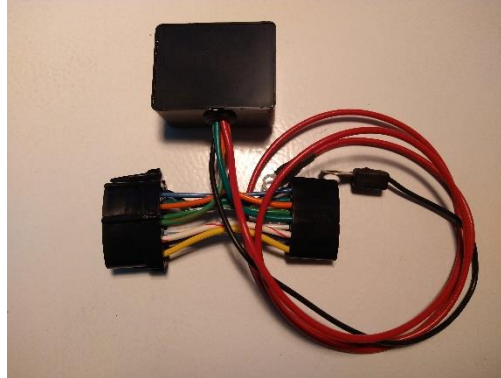

The **Switch Saver™** module solves the problem where the turn signal switch fails prematurely. This is due the high current used by the rear incandescent bulbs which overheats the contacts, melts the plastic, and causes the switch fail. Typically, either the brake lights fail and/or the turn signals fail.

- Easy to follow instructions
- Prevents factory turn signal failure by bypassing the switch rear lamp contacts
- Plugs into the original harness connectors with factory style connector pins
- Connects to existing emergency/stop light circuit breaker
- *Requires operational* turn signal switch right front, left front, right rear, left rear function.

Note: Since the flashers (or indicator relay) and turn signal switch is bypassed, electronic flashers or indicator relays are required (available separately) for proper dash indicator light operation.

1967 Cougar	C7WY-13L366-AR
1968 Cougar	C8WY-13L366-AR
1969-73 Cougar	C9WY-13L366-AR
1967 Thunderbird w/o cruise	C7SZ-13L366-AR
1968-early 1969 Thunderbird w/o cruise	C8SZ-13L366-BR
1969-1971 Thunderbird w/o cruise	C9SZ-13L366-BR

Turn Signal Indicator Relays

for: 1967-1968 Cougars
1965-1968 Thunderbirds

This is the relay under the dash that makes the “clicking” sound for the turn signal indicator on Cougars and Thunderbirds.


When it fails, the indicator lights on the dash or fender stop flashing when there is a heavy alternator load (i.e. brake lights, headlights, and/or AC).

- Replaces the failure-prone OEM part
- **Restores** turn signal “clicking” sound
- “Plasma” LED and 1157 bulb compatible.
- Automatically adjusts for a wide range of current loads.
- Manual adjustment control provided.
- No “bulb out” feature – always clicks.

C5SZ-13A366-CR:	Fits 1965-67 Thunderbirds
C7WY-13A366-BR	Fits 1967 Cougars (determines right or left)
C7WY-13A366-CR:	Fits 1967 Cougars
C8WY-13A366-AR:	Fits 1968 Cougars
C8SZ-13A366-BR:	Fits 1968 Thunderbirds before 11/6/67
C8SZ-13A366-DR:	Fits 1968-69 Thunderbirds from 11/6/67 to 10/15/68



C5SZ-13A366-CR 1965-67 Thunderbird

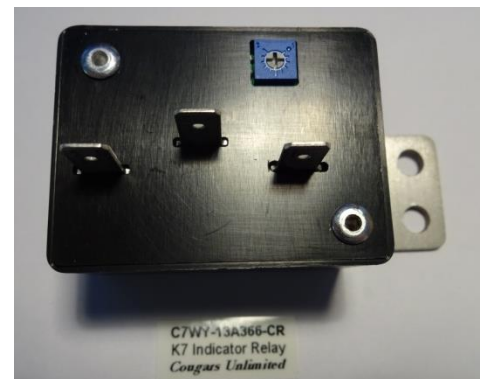

C7WY-13A366-CR 1967 Cougar

Sequential Turn Signal Controller

for: 1969-1973 Cougars
 1969-1971 Thunderbirds
 1969-1970 Shelby Mustangs



Easy to install, the C9WY-13A366-AL sequential controller includes:

- Replacement electronic sequencer ready to install in your OEM case
- Original style molded connectors, just plug it in!
- Installation guide with turn signal system diagrams and trouble-shooting hints

- * Works with "Plasma" LED, Tower LED, or incandescent tail light bulbs (not included)
- * Solid state, no relays to wear out!
- * Provides maximum light brightness

Two year warranty, Designed and built in the USA!

Note: D0WY-13350-L Electronic flasher is required (not included).

1971 Cougars built from 2/1/71 - 5/15/71 must convert taillight harness to red/black connectors using C9WY-13H366-AR pigtail kit.

When using front LED lights on 1970 & 1971 Cougars, an LED side marker adapter kit is required:

1970 Cougar	D0WY-15A434-LSM
1971 Cougar	D1WY-15A434-LSM

Makers of Cougar and Thunderbird Electronic Sequencers since 1981

“Plasma” LED Bulbs

- *Twice* as bright as 1157 bulbs!
- Use only 1/7th the current, lower alternator load!
- Won't fry your turn signal switch like 1157 bulbs!
- Compatible with all Cougars Unlimited sequential systems – each bulb contains a unique dual-diode isolation circuit.

WCCC1157R: Red tail light bulbs

WCCC1157Y: Yellow front turn signal bulbs

Note: Use of front LED bulbs on most 1970-71 Ford vehicles requires a LED Side Marker Adapter for each side marker bulb (see below for more information).



LED Side Marker Light Adapter kit

When using front LED lights on 1970-71 Ford vehicles, an LED side marker adapter kit is required:

1970 Cougar: D0WY-15A434-LSM (4 adapters and LEDs)

1971 Cougar: D1WY-15A434-LSM (2 adapters and LEDs)

The LED Side Marker Light Adapter kit is required when the C9WY-13A366-AL or the TS-400 Sequential controller is installed with LED front turn signal and LED side marker bulbs on 1970-71 Ford vehicles that have side marker lights that flash opposite to the turn signals when the head lights are on.

This adapter solves the problem where the side marker voltage feeds back through the front turn signal bulb when the running lights or headlights are turned on. When this happens all the rear bulbs may flash together and/or it may trigger the front turn signal bulb to turn on.

This problem occurs because the high side of the front turn signal element is used as the ground for the side marker lights. The adapter solves this problem by providing a direct ground path for each side marker light. An adapter is required for each side marker light. LED bulbs are included in the kit.

These adapters maintain the original Ford factory function of the side maker lights:


1. light up solid when the headlights or parking lights are on;
2. flash in unison with the front turn signal when the headlights or parking lights are off;
3. flash alternating with the front turn signal when the headlights or parking lights on.



ELECTRONIC SEQUENTIAL TURN SIGNAL FLASHERS

for COUGARS and THUNDERBIRDS

Replace that failure-prone mechanical turn signal flasher with a trouble-free silent electronic unit!

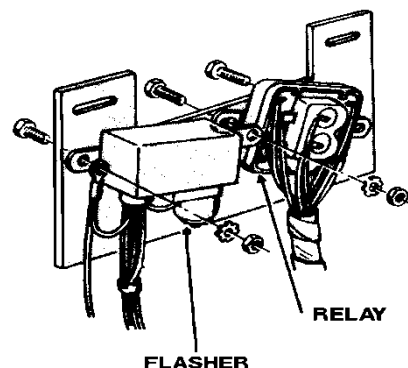

- Original style molded connectors and mounting bracket
- Includes an installation and trouble-shooting guide
- Mounted inside a sturdy ABS plastic case
- NO wiring changes - just plugs in!

Three models to choose from:

CE-1: Fits 1967-1968 Cougar
1967-1968 Thunderbird (before 11/6/67)
(replaces obsolete part C7SZ-13350-C)

TE-1: Fits 1965-1966 Thunderbird
(replaces obsolete part C5SZ-13350-A)


CE-300: Fits 1969 Chrysler Imperial
(replaces obsolete Mopar PN 2926498 or 2947709)



CE-1 (TE-1, CE-300 similar)

SEQUENTIAL TURN SIGNAL RELAYS

for Cougars and Thunderbirds

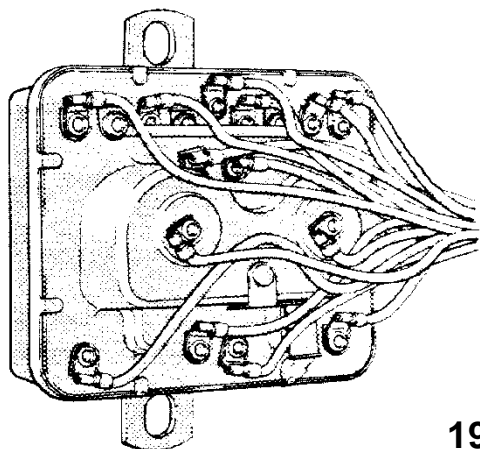

C7WY-13A366-AR
1965-67 T-Bird/Cougar



C8SZ-13A366-AR
1968 T-Bird/Cougar

The directional relay kit includes:

- Replacement directional relay mounted in a sturdy ABS plastic case
- Original style molded connectors and mounting bracket
- Installation and trouble-shooting guide
- NO wiring changes - just plugs in!

Four models to choose from:

C7WY-13A366-AR: 1967 Cougar and 1965-67 T-Bird

C8SZ-13A366-AR: 1968 Cougar
1968 T-Bird (before 11/6/67)
w/o auxiliary stop lamp

C8SZ-13A366-ER: 1968-69 T-Bird (from 11/6/67)
w/o auxiliary stop lamp

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981


Not affiliated with the Ford Motor Company

STOP LAMP RELAY

for Cougars and Thunderbirds

The stop lamp relay kit includes:

- Replacement relay rated at 40 Amps
- Original style molded 4-pin connector
- Installation instructions
- NO wiring changes - just plugs in!

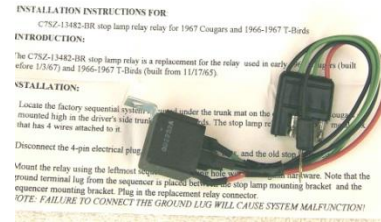

C5SZ-13482-AR: 1965-early 1966 T-Bird w/3-pin connector

C5SZ-14A303-AD: 1965-early 1966 T-Bird Stop lamp adapter

Use to install 4-pin connector stop lamp relay in 3-pin T-Bird.

C6SZ-14A303-AD: 1966 T-Bird Stop lamp adapter

Use to install 3-pin connector stop lamp relay in 4-pin T-Bird.

C7SZ-13482-BR: 1967 Cougar (before 1/3/67)


1966-67 T-Bird (before 1/16/67) w/4-pin connector

EMERGENCY WARNING RELAY

for 1967-1968 Cougars

Does your Cougar only flash the center light on each side?

Problem solved! Replace your old relay with a modern replacement relay.

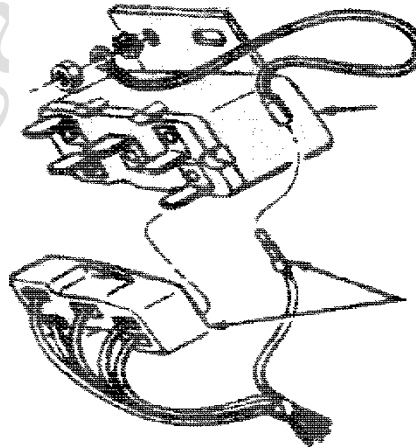

The emergency relay kit includes:

- Replacement relay module
- Original style connectors with new mounting hardware
- NO wiring changes - just plugs in!
- Mounts in trunk on LH fiberboard trunk well cover

C7WY-10B926-AR: Fits all 1967-1968 Cougar

C7WY-10B926-BR: Fits all 1967 Cougar (located under dash)

C7WY-10B926-CR: Adapter for 1967-68 Cougar/T-Bird with GM turn signal switch

Copyright © Cougars Unlimited LLC

Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company


ELECTRONIC SEQUENTIAL TURN SIGNAL SYSTEM

for 1967-1968 Cougars

The system replaces *all* these parts found in your Cougar trunk:

- Sequential flasher and motor
- Directional relay
- Emergency relay (5-pin)
- Stop lamp relay (early 67 only)

New Generation – no emergency relay wire required!

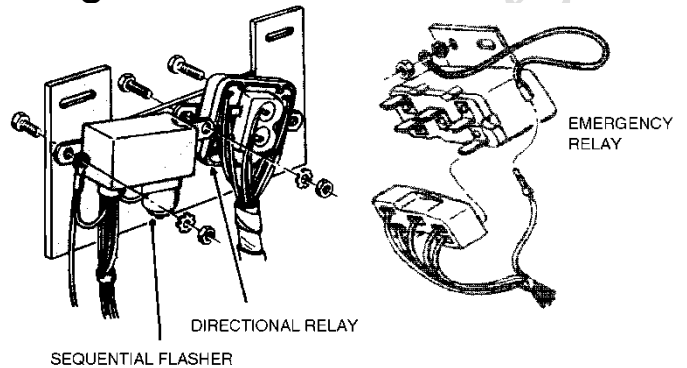

Easy to install, the sequential system kit includes:


- Replacement electronic sequential module
- Original style molded connectors and mounting bracket
- Mounted in a sturdy ABS plastic case
- Installation and trouble-shooting guide
- NO wiring changes - just plugs in!

Three models to choose from:

C7WY-13A366-AS: 1967 Cougar built before 1/3/67 (with stop lamp relay)

C7WY-13A366-BS: 1967 Cougar built after 1/2/67 (without stop lamp relay)

C8WY-13A366-AS: 1968 Cougar

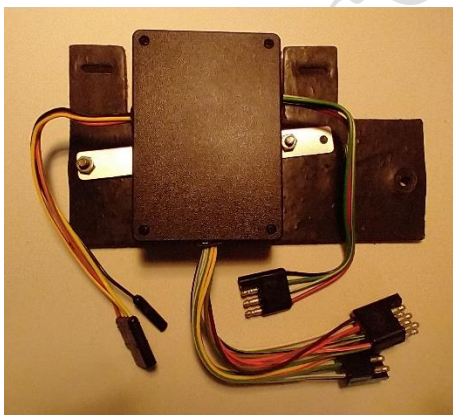

C7WY-13A366-AS



C8WY-13A366-AS (C7WY-13A366-BS similar)

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981


Not affiliated with the Ford Motor Company

ELECTRONIC SEQUENTIAL TURN SIGNAL SYSTEM

for 1965-1968 Thunderbirds


The system replaces *all* these parts found in your Thunderbird trunk:

Sequential flasher and motor
Directional relay
Stop lamp relay

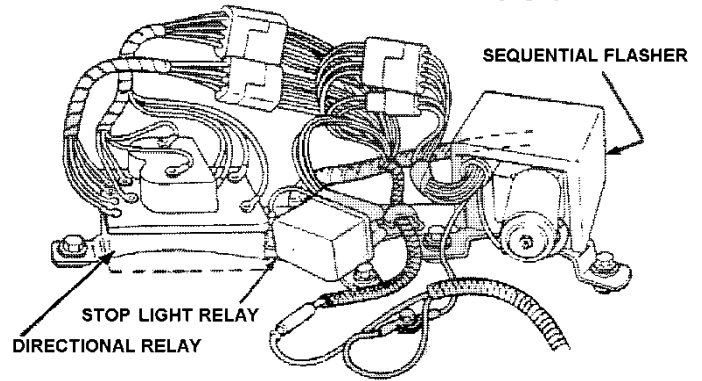

Easy to install, the sequential system kit includes:

- Replacement electronic sequential module
- Original style molded connectors and mounting bracket
- Mounted in a sturdy ABS plastic case
- Installation and trouble-shooting guide
- NO wiring changes - just plugs in!

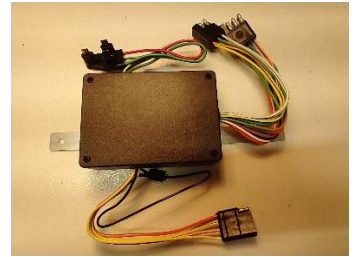

C5SZ-13A366-AS

With 3-pin stop lamp relay

Four models to choose from:

C5SZ-13A366-AS: 1965 and 1966 Thunderbird (before 11/17/65)
with 3-pin stop lamp relay

C6SZ-13A366-AS: 1966 Thunderbird (from 11/17/65)
with 4-pin stop lamp relay

C7SZ-13A366-AS: 1967 Thunderbird (before 1/16/67)
with stop lamp relay

C7SZ-13A366-BS: 1967 Thunderbird (from 1/16/67)
w/o stop lamp relay

C7SZ-13A366-BS: 1967 Thunderbird (from 1/16/67)
w/o stop lamp relay

C8SZ-13A366-AS: 1968 Thunderbird
w/o Auxiliary stop lights

C8SZ-13A366-CS: 1968-69 Thunderbird (from 5/1/68 to 10/15/68)
w/trunk relay marked C8WB-13A366-B



C6SZ-13A366-AS

With 4-pin stop lamp relay

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109



www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

ELECTRONIC SEQUENTIAL TURN SIGNAL SYSTEM

for: 1969-1973 Cougars
1969-1971 Thunderbirds
1969-1970 Shelby Mustangs

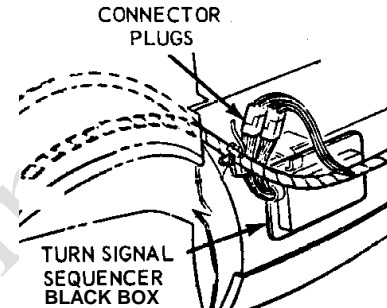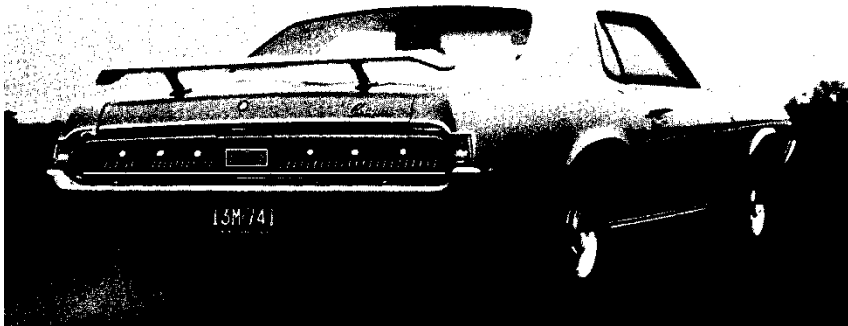

The sequential sequencer kit includes:

- Replacement electronic sequencer ready to install in your case
- Original style molded connectors, pre-soldered in place
- Installation guide with turn signal system diagrams and troubleshooting guide

- * Solid state, no relays to wear out!
- * Designed for maximum light brightness
- * Protected against improper installation
- * **Note:** Requires electronic flasher can (*not included*) Use **D0WY-13350-AR** with 1157 bulbs. Use **D0WY-13350-L** for LED bulbs.
- * Also fits 1969 T-Bird built from 10/15/68 with electronic sequencer

C9WY-13A366-AL: Replaces Ford parts C9WY-13A366-A, D1WY-13A366-A
C9WY-13A366-ADJ: With adjustable time delay between bulbs

Note: 1971 Cougars built from 2/1/71 - 5/15/71 must convert taillight harness to red/black connectors, C9WY-13H366-AR pigtail kit.



Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981
Not affiliated with the Ford Motor Company

www.cougarsunlimited.net

ELECTRONIC FLASHER CAN for

1969-1973 Cougars

1969-1971 Thunderbirds

1967-1970 Shelby Mustangs

Do your sequential turn signals flash too fast?

Do your lights all flash together?

Does the last light flash too dim?

Problem solved!

Replace your old flasher can with a modern *electronic* unit.

Improved! Now with 70% ON-time!

The flasher kit includes:

- Replacement 2-pin flasher module
- Installation instructions

DOWY-13350-AR: Replaces parts DOWY-13350-A, DOWY-13350-C, and 552 emergency flashers. Use with 1157 bulbs.

DOWY-13350-AR5: Replaces Ideal 429 or Tung-Sol 420 flasher. Use in 1968 Shelby Mustangs with 1157 bulbs.


DOWY-13350-L: Replaces parts DOWY-13350-A, DOWY-13350-C flashers. Use with "Plasma" LED bulbs.

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

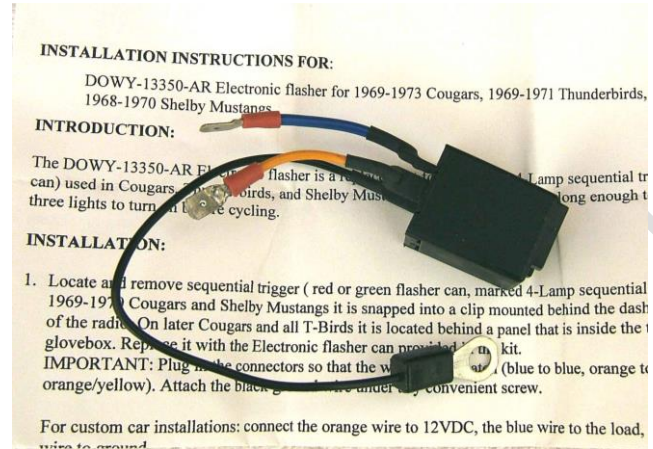

ELECTRONIC FLASHER CAN for 1964 Thunderbird with sequential lights

Do your sequential turn signals flash too fast?
Do your lights all flash together?
Does the last light flash too dim?
Do your lights not flash at all?

Problem solved!

Replace your old flasher can with a modern *electronic* unit.

The flasher kit includes:

- Replacement 3-pin flasher module
- Installation instructions

C4SZ-13350-AR: Replaces Ford part C4SZ-13350-A
Use with 1157 and "Plasma" LED bulbs.



Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109


www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981
Not affiliated with the Ford Motor Company

ELECTRONIC SEQUENTIAL TURN SIGNALS

For cars with 3, 4 or 5 tail lights per side

Now your custom car or Hot Rod can have sequential turn signals, just the like the Cougars and Thunderbirds!

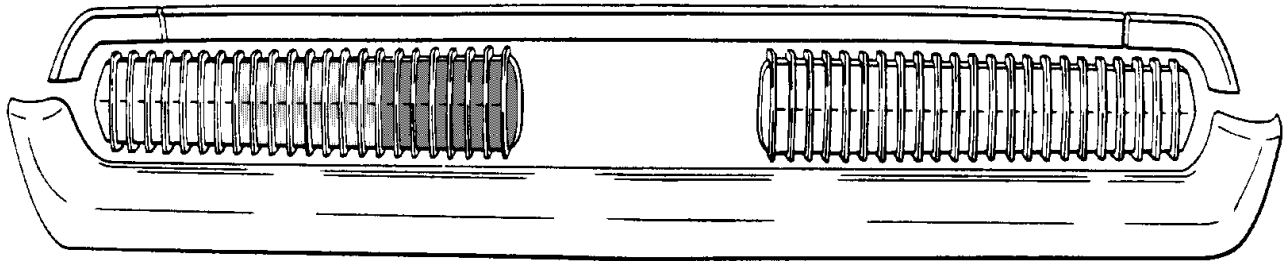

The electronic sequencer kit includes:

- Cougar-style sequencer in a sturdy ABS plastic case
- Wiring harness with molded connectors
- Mounting bracket
- Installation guide

- * Solid state, no relays to wear out
- * Designed for maximum light brightness

- * Protected against improper installation
- * Includes electronic flasher

This unit can also be used in existing conversions based on 1969-1973 Cougar and Thunderbird turn signal systems!

The unit is designed for cars with combined turn signal and brake lights. A special adapter for cars with separate turn signals and brake lights is available. *Note: Not for use on 1965-early 68 T-Birds or 1967-68 Cougars unless aftermarket harness is installed.*

TS-400: use with 3 LED incandescent bulbs or 1157 bulbs

TS-4: use with LED bulbs only

TS-5: use with LED bulbs only



Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net


Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

1964 Thunderbird

ELECTRONIC SEQUENTIAL TURN SIGNALS

*Now your 1964 Thunderbird can have sequential turn signals,
just the like the 1965-71 Thunderbirds!*

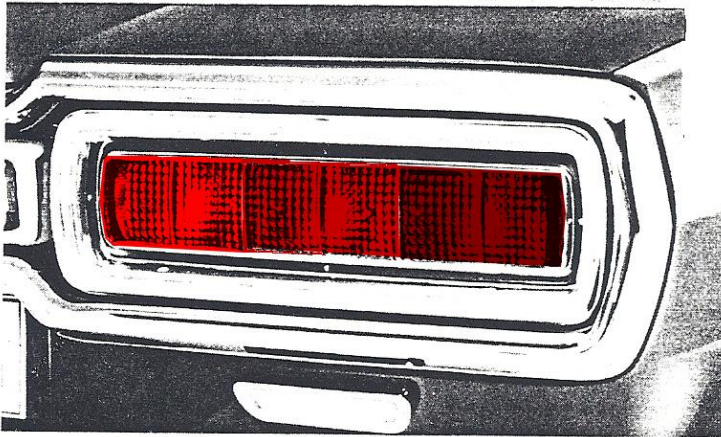

The **TS-64T** sequencer kit includes:

- 1969 Thunderbird-style sequencer in a sturdy ABS plastic case
- Wiring pigtails with molded connectors
- Mounting bracket
- Installation guide

- * Solid state, no relays to wear out
- * Designed for maximum light brightness

- * Protected against improper installation
- * Includes 3-pin electronic flasher

TS-400-64T: use with "Plasma" or 1157 incandescent bulbs LED bulbs

Note: 1965 T-Bird style tail light plugs and harness with individually wired sockets are not included – order separately or modify your original harness.

C5SB-13407-AR: Tail light bezel harness with sockets (2 required)

C5SZ-14405-P2: Tail light harness plugs, sequencer side (2 required)

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

"Dynamite Stick" style **ELECTRONIC TURN SIGNAL SEQUENCERS** for 1968 Shelby Mustangs, California Specials and *Eleanor* Clones



Easy to install, the sequencer kit includes:

- Replaces FORD part S8MS-13A366-A
- Two sequencer modules - one for each side
- Original style connectors ready to plug into T-Bird tail light harness
- Original Scotch-Lok connectors
- Installation instructions for 1968 Shelby and custom cars

S8MS-13A366-LK For use with 1157, Tower, or the "Plasma" LED bulbs.

*Requires two **DOWY-13350-AR5** flasher cans with incandescent bulbs(not included)*

*Or use two **DOWY-13350-L** flasher cans with LEDs (not included)*

1968 Shelby and California Special tail light harness parts:

C5SZ-13407-AR 1968 Shelby/T-Bird Tail light bezel harness w/sockets – two required.

C5SZ-14405-P1 Tail light harness repair plug (tail light side, two required to build custom tail light harness if C5SZ-13407-AR harnesses are not used)

C5SZ-14405-P2 Tail light harness repair plug (sequencer side, two required for "Dynamite Sticks" without connectors, included in S8MS-13A366-AK kit)

Copyright © Cougars Unlimited LLC

Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

Turn Signal Switches

Made in the USA with the Original or Improved Tooling

Application	Without Tilt Column	With Tilt Column
1967 Cougar/Mustang Shelby Mustang	C7ZZ-13341-FR	C7ZZ-13341-FR
1968 Cougar/Mustang Shelby Mustang	C8SZ-13341-AR	C8ZZ-13341-BR or C8SZ-13341-BR
1969 Cougar/Mustang Shelby Mustang	C9AZ-13341-BR	C8ZZ-13A366-BR or C8SZ-13341-BR
1970-72 Cougar Mustang	D2AZ-13341-CR <i>Use with LEDs only</i>	D2AZ-13341-DR With pins
1967 Thunderbird w/o cruise control	N/A	C7SZ-13341-ER
1967 Thunderbird with cruise control	N/A	C7SZ-13341-ER (disables Cruise)
1968 Thunderbird	C8SZ-13341-AR	C8SZ-13341-BR
1969 Thunderbird w/o cruise control	C9SZ-13341-AR	C9SZ-13341-BR
1969 Thunderbird with cruise control		C9SZ-13341-CR (disables Cruise)
1970-71 Thunderbird	D1SZ-13341-AR	D1SZ-13341-BR
1971-72 Cougar Mustang	D2AZ-13341-CR	D2AZ-13341-DR
1973 Cougar/Mustang	D3AZ-13341-AR	D3AZ-13341-BR
1967 Cougar/Mustang 10-pin rectangular connector	C5SZ-14489-A C5SZ-14489-B	Turn signal SW 14401 Harness
1968-72 Cougar, Mustang Half-moon connector	C8SZ-14489-S C8AZ-14489-AA	Turn signal SW 14401 Harness
Female pins Male pins	C4AZ-14461-AR C4AZ-14488-BR	Requires special pin extractor and crimping tools
Turn Signal Switch connector female pin extractor	C4AZ-17018-X	C4AZ-17018-X

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

Cougar Wiring Harnesses

Dash to Engine Gauge Feed Harness

This underhood harness connects from the firewall to the distributor, water temp sender, and oil pressure sender.

C6DZ-14289-BR 1967-68 289/302 with push-on oil sender
C7DZ-14289-BR 1967-68 289/302 with slide-on clip oil sender
C7GB-14289-AR 1967 390 (early) with HD black oil/water sender wires
C7ZZ-14289-AR 1967-68 390/427/428 with push-on oil sender
D4AZ-14289-RR 1969-70 351W with push on oil sender
D0AZ-14289-AR 1969-70 390/428 with push-on oil sender
D0ZZ-14289-AR 1970 351C 2V/4V
D1OZ-14289-AR 1971 351C 2V/4V

Dash Panel to Headlamp Wiring Harness

This underhood harness connects from the firewall to the starter solenoid and front lights.

C7WY-14290-JR	1967 Cougar
C7WY-14290-HR	1967 XR7 Cougar
C8WY-14290-AR	1968 Cougar
C8WY-14290-BR	1968 XR7 Cougar
C9WY-14290-AR	1969 Cougar
C9WY-14290-LR	1969 XR7 Cougar – <i>now with 16 ga ground!</i>

Headlamp Wiring Harness Extension

C9WY-13076-AR 1969 Cougar – All, with mounting clip.

Brake Switch Harness Extension

C8ZZ-13K408-AR 1968 Cougar – With disc brakes.

Tail Light Wiring Harness

C9WY-14405-RR 1969 Cougar XR7

Fuel Gauge Sending Harness

C8WB-14406-BR Use to convert adapt a 1967-70 Cougar XR7 fuel sender harness to standard Cougar one-pin sending unit.

Copyright © Cougars Unlimited LLC
 Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

Cougar Wiring Harnesses

Alternator Harness

C7ZZ-14305-BR	1967-68 289-302 with ammeter (XR7)
C7ZZ-14305-CR	1967 390 with ammeter w/o TE (XR7)
C7ZZ-14305-DR	1967 390 std w/o ammeter w/o TE
C7ZZ-14305-ER	Alternator harness 1967 289 std w/o ammeter
C8ZB-14305-FR	1968 390-427-428 std w/o ammeter NEW!
C8WB-14305-DR	1968 289-302 std w/o ammeter
C8WB-14305-ER	1967 390 w/ TE, 1968 390-427-428 with ammeter (XR7)
C9WY-14305-GR	1969 All w/o ammeter
C9ZZ-14305-SR	1969 All with ammeter (XR7)
D0WY-14305-CR	1970 All Std w/o ammeter
D0ZZ-14305-CR	1970 All with ammeter (XR7)
D1OZ-14305-BR	1971 All Std w/o ammeter
D1ZZ-14305-BR	1971 All with ammeter (XR7)



Copyright © Cougars Unlimited LLC
 Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981
 Not affiliated with the Ford Motor Company

Cougar Wiring Harnesses

1968 Cougar Front Marker Lamp Harness



Replace your corroded light socket and harness!

C8WB-15A442-APR for 1968 Cougar
Sold as a pair.

Note: This original style socket is for the original 2-pin lamp, 1178A.
The L/M parts catalog and owners manual *incorrectly* lists the single pin
97A bulb as the replacement bulb.

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981
Not affiliated with the Ford Motor Company

Cougar Wiring Harnesses **1967-68 Cougar Door Harness**



C7WY-13A769-AR XR7, With door ajar



C8WY-13A709-B XR7, With door ajar

(Will also fit standard Cougar by removing door ajar switch wire.)

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company

Cougar Wiring Harnesses Repair Pigtails

Repair your wiring harness with replacement pigtails for cut or damaged wire connectors


- C8WB-13234-AR** 1967-70 Cougar front Turn signal bezel harness pigtail with glued wires
- C7AB-14488-RB** 1967-70 Starter solenoid rt angle pigtails, pr.
- C8ZZ-AM-A** 1967-70 AM, AM-FM, or AM 8-Track 2-pin radio-side power connector, 12" leads
- C8ZZ-AM-B** 1967-70 AM, AM-FM, or AM 8-Track 2-pin harness-side power connector, 12" leads
- C8ZZ-AMFM-C** 1968-70 AM-FM, or AM 8-Track 3-pin radio-side power connector, 12" leads
- C8ZZ-AMFM-D** AM-FM, or AM 8-Track 3-pin speaker-side power connector, 12" leads
- C5SZ-13H366-AR** 1965-66 Thunderbird, 3-pin stop light relay, 6-pin, 8-pin, 1-pin ground, and two 4-pin connector set
- C7WY-13H366-AR** 1966-67 Thunderbird, 1967 Cougar with 4-pin stop light relay, 6-pin, 8-pin, 1-pin ground, and two 4-pin connector set
- C7WY-13H366-BR** 1967 Thunderbird, 1967 Cougar with 4-pin stop light relay, 6-pin, 8-pin, 1-pin ground, and one 4-pin connector set
- C8WY-13H366-AR** 1968-69 Thunderbird (early), 1968 Cougar with 4-pin red, 4-pin black square, 4-pin white square, 4-pin flat, 2-pin, and 1-pin connector set
- C9WY-13H366-AR** 1969-71 Thunderbird (late), 1969-73 Cougar, 1969-70 Shelby with 5-pin red, 5-pin black connector set
- C5SZ-14405-P1** 1968 Shelby, 1965-66 **Thunderbird** Tail light harness repair plug (tail light side, two required to build custom tail light harness if C5SZ-13407-AR harnesses are not used)
- C5SZ-14405-P2** 1968 Shelby Tail light harness repair plug (sequencer side, two required for "Dynamite Sticks" without connectors, included in S8MS-13A366-AK kit)
- C9AZ-14526-ER** 1969-72 Cougar/Mustang/Ford 16 ga fusible link

SPARE TIRE HOLD DOWN PLATE

for 1968-69 COUGARS and Mustangs
with styled steel wheels

An exact reproduction

C8MY-1424-AR

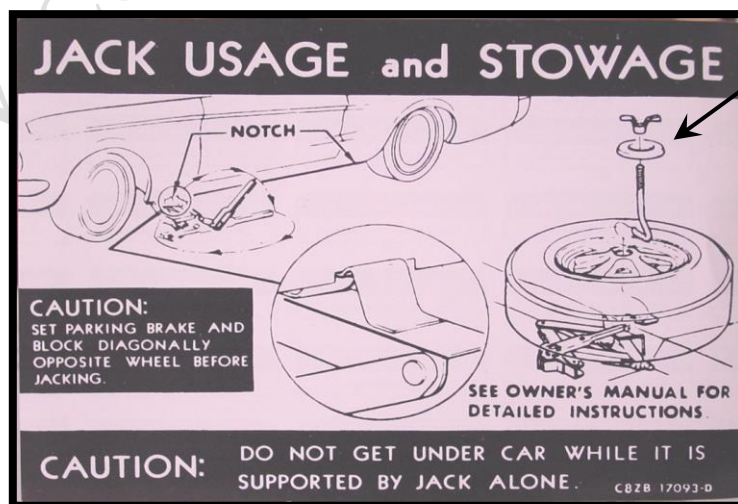

Copyright © Cougars Unlimited LLC
Cougars Unlimited LLC, 6831 Truchas DR NE, Albuquerque, NM 87109

www.cougarsunlimited.net

Manufacturer of Electronic Sequencers since 1981

Not affiliated with the Ford Motor Company



Part Number	Description	Vehicle Application	MSRP	Notes
C5SZ-13A366-AS	Turn Signal System	1965-1966 T-Bird (before 11/17/65)	\$314.95	
C6SZ-13A366-AS	Turn Signal System	1966 T-Bird (from 11/17/65)	\$314.95	
C7SZ-13A366-AS	Turn Signal System	1967 T-Bird (before 1/16/67, with stop lamp relay)	\$314.95	
C7SZ-13A366-BS	Turn Signal System	1967 T-Bird (from 1/16/67, w/o stop lamp relay)	\$314.95	
C7WY-13A366-AS	Turn Signal System	1967 Cougar (before 1/3/67, with stop lamp relay)	\$314.95	
C7WY-13A366-BS	Turn Signal System	1967 Cougar (from 1/3/67, w/o stop lamp relay)	\$314.95	
C8WY-13A366-AS	Turn Signal System	1968 Cougar	\$314.95	
C8SZ-13A366-AS	Turn Signal System	1968 Thunderbird (before 11/6/67, w/o auxiliary stop lights)	\$314.95	
C8SZ-13A366-CS	Turn Signal System	1968-69 Thunderbird 5/1/68 to 10/15/68. For cars with C8WB-13A366-B directional relay in trunk.	\$314.95	
C9WY-13A366-AL	"Plasma" LED Turn Signal Sequencer	1969-1973 Cougar except 1971 built 2/1/71 - 5/15/71 (which must reuse original connectors), 1969-1970 Shelby Mustang, 1969-1971 T-Bird (from 10/15/68) Use D0WY-13350-L electronic flasher and WCCC1157R LED tail light bulbs or Use D0WY-13350-AR with 1157	\$196.60	
C9WY-13A366-ADJ	"Plasma" LED Turn Signal Sequencer – with Adjustable delay between lights	1969-1973 Cougar except 1971 built 2/1/71 - 5/15/71 (which must reuse original connectors), 1969-1970 Shelby Mustang, 1969-1971 T-Bird (from 10/15/68) Use D0WY-13350-L electronic flasher and WCCC1157R LED tail light bulbs or Use D0WY-13350-AR with 1157	\$209.95	
C9WY-13A366-AR	Sequential Turn Signal System	1969-73 Cougar/Shelby/Thunderbird		Discontinued, R/B C9WY-13A366-L
TS-400	"Plasma" LED Sequential Turn Signal System	Universal, for customizing cars with 3-lamp tail lights. Includes one 2-pin D0WY-13350-AR electronic flasher. Compatible with 1157 Incandescent or WCCC1157R LED tail light bulbs.	\$278.90	



Part Number	Description	Vehicle Application	MSRP	Notes
TS-400-ADJ	"Plasma" LED Sequential Turn Signal System – with Adjustable delay between bulbs	Universal, for customizing cars with 3-lamp tail lights. Includes one 2-pin D0WY-13350-AR electronic flasher. Compatible with 1157 Incandescent or WCCC1157R LED tail light bulbs.	\$293.90	NEW!
TS-400F	"Plasma" LED Sequential Turn Signal System	Universal, for customizing cars with 3-lamp tail lights and separate brake/turn lamps. Includes one 2-pin D0WY-13350-AR electronic flasher. Note: Compatible with 1157 incandescent or WCCC1157R LED tail light bulbs.	\$318.75	
TS-1	Sequential Turn Signal System	Universal, for customizing cars with 3-lamp tail lights. Includes one 2-pin D0WY-13350-AR electronic flasher. 1157 bulbs only.		Discontinued, R/B TS-400
TS-4	4-segment LED Sequential Turn Signal System	Universal, for customizing cars with 4-lamp LED tail lights. Includes one 2-pin D0WY-13350-AR electronic flasher. Note: Requires WCCC1157R tail light LED bulbs.	\$312.70	
TS-5	5-segment LED Sequential Turn Signal System	Universal, for customizing cars with 5-lamp LED tail lights. Includes one 2-pin D0WY-13350-AR electronic flasher. Note: Requires LED tail light bulbs.	\$398.45	
TS-1LED Adapter	LED Adapter kit	LED Adapter kit - use with C9WY-13A366-AR or Ford OEM sequencer with Tower LED bulbs	\$60.35	Limited Quantity
TS-400-64T	"Plasma" LED Sequential Turn Signal System	1964 Thunderbird. Includes one 3-pin C4SZ-13350-AR flasher. Note: Requires WCCC1157R tail light LED bulbs.	\$289.75	
TS-64T	Sequential Turn Signal System	1964 Thunderbird. Includes one 3-pin C4SZ-13350-AR flasher. Use with 1157 bulbs only.		Discontinued, R/B TS-400-64T
CE-1	Sequential Flasher	1967-1968 Cougar, 1967-1968 T-Bird (before 11/6/67)	\$183.70	Limited Quantity
CE-300	Sequential Flasher	1969 Chrysler Imperial	\$209.95	Limited Quantity
TE-1	Sequential Flasher	1965-1966 T-Bird	\$181.10	Limited Quantity
TE-2	Sequential Flasher	1968-1969 T-Bird (from 11/6/67 to 10/15/68)		Discontinued, Replaced by C8SZ-13A366-AS or C8SZ-13A366-CS



2025 Price List Effective 02/01/25

Part Number	Description	Vehicle Application	MSRP	Notes
S8MS-13A366-AK	"Dynamite Stick" Sequential flasher, pr.	1968 Shelby Mustang. Note: Requires D0WY-13350-AR5 electronic flasher. (for 1157 bulbs only)		Discontinued, Replaced by S8MS-13A366-LK
S8MS-13A366-LK	"Dynamite Stick" Sequential flasher, pr.	1968 Shelby Mustang, pr. Note: Requires D0WY-13350-AR5 electronic flasher with incandescent 1157 bulbs or D0WY-13350-L with Plasma LED bulbs.	\$205.25	
C4SZ-13350-AR	Electronic Flasher can	1964 T-Bird, slow cycle rate - for use with electronic sequencer and 1157 bulbs.	\$53.00	
D0WY-13350-AR	Electronic Flasher can	1969-1973 Cougar, 1969-1971 T-Bird (from 10/15/68) Improved incandescent bulb flasher – now with 70% on-time!	\$44.05	
D0WY-13350-AR5	Electronic Flasher can	1968-1970 Shelby, Improved 1157 flasher – now with 70% on-time! Use with OEM GE "Dynamite Sticks".	\$44.05	
D0WY-13350-L	Electronic LED Flasher can	1969-1973 Cougar, 1969-70 Shelby, 1969-1971 T-Bird (from 10/15/68) Improved LED flasher – now with 70% on-time!	\$44.05	NEW!
D0WY-13350-LE	Electronic LED Emergency Flasher can – with 50% duty cycle	1969-1973 Cougar, 1969-70 Shelby, 1969-1971 T-Bird (from 10/15/68) Use to replace D0WY-13350-B in OEM applications	\$44.05	NEW!
D0WY-13350-L27	Electronic LED Flasher can	Use with American Autowire Highway 22 Plus single flasher system, also fits Dodge pickup	\$48.25	NEW!
TSG-CD	1967 Cougar Sequential Turn Signal System Troubleshooting, Reprint of Factory manual	1967-68 Cougar	\$20.00	
TSG-1	1967 Cougar Sequential Turn Signal System Troubleshooting, Reprint of Factory manual	1967 Cougar		Discontinued Replaced by TSG-CD
TSG-2	1968 Cougar Sequential Turn Signal System Troubleshooting, Reprint of Factory manual	1968 Cougar		Discontinued Replaced by TSG-CD
C7WY-10B926-AR	Emergency Warning Relay	1967 - 1968 Cougar (K10 in trunk)	\$66.40	
C7WY-10B926-BR	Emergency Warning Relay	1967 Cougar (K6 3-pin under dash)	\$53.10	
C7WY-10B926-CR	Emergency Warning Relay Adapter for GM column/turn signal switch	1967-68 Cougar/T-Bird	\$78.70	NEW!
C5SZ-13A366-CR	Indicator Relay, 1157 or Plasma LED	1965-67 Thunderbird (3-pin under dash)	\$134.95	
C7WY-13A366-AR	Directional Relay	1967 Cougar, 1965-1967 T-Bird (K8/K9 in trunk)	\$181.10	Limited Quantity



2025 Price List Effective 02/01/25

Part Number	Description	Vehicle Application	MSRP	Notes
C7WY-13A366-BR	Indicator Relay	1967 Cougar (K5 4-pin under dash)	\$53.10	
C7WY-13A366-CR	Indicator Relay, 1157 or Plasma LED	1967 Cougar (K7 3-pin under dash)	\$124.95	
C8SZ-13A366-AR	Directional Relay (in trunk)	1968 Cougar, 1968 T-Bird w/o Auxiliary stop lamp (before 11/6/67)	\$181.10	Limited Quantity
C8SZ-13A366-BR	Indicator Relay 1157 or Plasma LED	1968 Thunderbird (before 11/6/67, under dash)	\$134.95	
C8SZ-13A366-DR	Indicator Relay 1157 or Plasma LED	1968 Thunderbird (from 11/6/67, under dash)	\$134.95	
C8SZ-13A366-ER	Directional Relay (in trunk)	1968-69 T-Bird w/o Auxiliary stop lamp (from 11/6/67)	\$181.10	Limited Quantity
C8WY-13A366-AR	Indicator Relay 1157 or Plasma LED	1968 Cougar (K5 3-pin under dash)	\$124.95	
C8WY-13A366-BR	Directional Relay (in trunk)	1968-69 T-Bird with Auxiliary stop lamp (from 5/1/68)		Discontinued, Replaced by C8SZ-13A366-CR
C5SZ-13482-AR	Stop Lamp Relay (3-pin)	1965-1966 T-Bird (before 11/17/65)	\$60.35	Limited Quantity
C7SZ-13482-BR	Stop Lamp Relay (4-pin)	1967 Cougar (early, before 1/3/67), 1966-1967 T-Bird (from 11/17/65 to 1/15/67)	\$53.10	Limited Quantity
C7ZZ-3D568	Tilt column harness	1967 Cougar	\$100.00	
C8ZZ-3D568	Tilt column harness	1968 Cougar	\$100.00	
C9ZZ-3D568	Tilt column harness	1969 Cougar	\$75.00	
C9WY-13076-AR	Headlight harness (R or L) w/clip	1969 Cougar	\$30.15	
C8WB-13234-AR	Front Turn signal bezel harness pigtail with glued wires	1967-70 Cougar	\$15.65	
C5SZ-13H366-AR	Taillight harness repair kit for cut plugs	1965-66 Thunderbird: 3-pin stop light relay: 6-pin, 8-pin, 3-pin, 1-pin ground, and 4-pin connector set	\$50.40	New!
C7WY-13H366-AR	Taillight harness repair kit for cut plugs	1966-67 Thunderbird, 1967 Cougar with 4-pin stop light relay: 6-pin, 8-pin, 1-pin ground, and two 4-pin connector set	\$36.90	
C7WY-13H366-BR	Taillight harness repair kit for cut plugs	1967 late Cougar/Thunderbird: 6-pin, 8-pin, 4-pin, and 1-pin connector set	\$32.40	
C8WY-13H366-AR	Taillight harness repair kit for cut plugs	1968 Cougar/Thunderbird: 4-pin red, 4-pin black square, 4-pin white square, 4-pin flat, 2-pin, and 1-pin connector set	\$32.40	
C9WY-13H366-AR	Taillight harness repair kit for cut plugs	1969-73 Cougar/Thunderbird: 5-pin red, 5-pin black	\$21.40	



2025 Price List Effective 02/01/25

Part Number	Description	Vehicle Application	MSRP	Notes
S8MS-13L366-AR	Sequential signal delete plug, ea.	1968 Shelby (two required)		Discontinued Replaced by C5SZ-14405-P2
C5SB-13407-AR	Tail light bezel harness with sockets	1965-66 T-Bird, 1968 Shelby (2 required)	\$90.60	
C8ZZ-13K408-AR	Brake light switch extension harness	1968 Cougar with disc brakes	\$35.65	New!
C7WY-13A769-AR	Door harness, right or left, each.	1967 Cougar with door ajar, 1967 XR7	\$66.40	
C8WY-13A709-BR	Door harness, right or left, each.	1968 with door ajar, 1968 XR7	\$66.40	
C7ZZ-13B711-AR	Console harness	1967-68 Cougar	\$31.45	New!
C7ZZ-13B712-AR	Dash to Console feed	1967-68 Cougar Std	\$31.45	New!
C8OZ-14A033-KIT	Auxiliary power feed kit - includes fuse clip, stud mount and wire	1969-72 Cougar	\$52.50	New!
C9ZZ-14K064-AR	Engine gauge extension	1969 Cougar, use with D0WY-10884-A temperature sender (no resistor in wire)		Discontinued
C6AB-14A163-K	Alternator loop wire clip, plastic	1967-70 Cougar	\$5.25	New!
C6DZ-14289-BR	For installation into fuse box	1967-68 Cougar 289/302 with push-on oil sender With longer wires to accommodate intake or block mounted coil when oil pressure sender is mounted on extension tube.	\$44.65	Improved!
C7DZ-14289-BR	Dash to Engine Gauge Feed	1967-68 Cougar 289/302 with slide-on clip oil sender	\$39.80	
C7GB-14289-AR	Dash to Engine Gauge Feed	1967 Cougar/Cyclone 390 with push-on post oil sender. Early production with HD black oil and temp sender wires.	\$60.35	Limited Quantity!
C7ZZ-14289-AR	Dash to Engine Gauge Feed	1967-68 Cougar 390/427/428 with push-on post oil sender	\$39.80	
D0AZ-14289-AR	Dash to Engine Gauge Feed	1969-70 Cougar 390/427/428 with push on post oil sender	\$39.80	
D0ZZ-14289-AR	Dash to Engine Gauge Feed	1970 Cougar 351C 2V/4V	\$39.80	
D1OZ-14289-AR	Dash to Engine Gauge Feed	1971 Cougar 351C 2V/4V	\$39.80	
D4AZ-14289-RR	Dash to Engine Gauge Feed	1969-70 351W	\$39.80	
C7WY-14290-HR	Dash panel to headlight	1967 Cougar XR7 (65B)	\$438.30	
C7WY-14290-JR	Dash panel to headlight	1967 Cougar standard (65A, 65C)	\$438.30	
C8WY-14290-AR	Dash panel to headlight	1968 Cougar standard (65A, 65C)	\$438.30	
C8WY-14290-BR	Dash panel to headlight	1968 Cougar XR7 (65B)	\$438.30	
C9WY-14290-AR	Dash panel to headlight	1969 Cougar standard (65A) (includes green connector shell and spacer)	\$452.80	
C9WY-14290-LR	Dash panel to headlight	1969 Cougar XR7 (65B) (includes green connector shell and spacer)	\$573.55	Improved! Now with 16 ga ground



2025 Price List Effective 02/01/25

Part Number	Description	Vehicle Application	MSRP	Notes
C5SZ-14A303-AD	Brake light adapter harness	Adapts 4-pin 1966 Thunderbird system for use in 3-pin 1965/early 1966 Thunderbird harness.	\$36.70	Limited Quantity
C6SZ-14A303-AD	Brake light adapter harness	Adapts 3-pin 1965 Thunderbird system for use in 4-pin late 1966 Thunderbird harness.	\$36.70	Limited Quantity
C7ZZ-14305-BR	Alternator harness	1967-68 289-302 with ammeter (XR7)	\$39.80	
C7ZZ-14305-CR	Alternator harness	1967 390 with ammeter w/o TE (XR7)	\$39.80	
C7ZZ-14305-DR	Alternator harness	1967 390 std w/o ammeter w/o TE	\$43.85	
C7ZZ-14305-ER	Alternator harness	1967 289 std w/o ammeter	\$50.40	
C8ZB-14305-FR	Alternator harness	1968 390-427-428 std w/o ammeter	\$76.40	
C8WB-14305-DR	Alternator harness	1968 289-302 std w/o ammeter	\$76.40	
C8WB-14305-ER	Alternator harness	1967 390 with ammeter w/ TE (XR7) 1968 390/427/428 XR7	\$76.40	
C9WY-14305-GR	Alternator harness	1969 All w/o ammeter	\$83.45	
C9ZZ-14305-SR	Alternator harness	1969 All with ammeter (XR7)	\$42.35	
D0WY-14305-CR	Alternator harness	1970 All Std w/o ammeter	\$83.35	
D0ZZ-14305-CR	Alternator harness	1970 All with ammeter (XR7)	\$58.00	
D1OZ-14305-BR	Alternator harness	1971 All Std w/o ammeter	\$67.50	
D1ZZ-14305-BR	Alternator harness	1971 All with ammeter (XR7)	\$67.50	
C5SZ-14405-P1	Tail light harness plug (tail light side)	1965-66 T-Bird, 1968 Shelby, 8" pigtail (2 reqd)	\$11.50	
C5SZ-14405-P2	Tail light harness plug (sequencer side)	1968 Shelby, 8" pigtail (2 reqd)	\$11.50	
C9WY-14405-RR	Tail light harness	1969 XR7 With sockets. Can be used on 1969 standard when used with adapter below.	\$531.25	Limited Quantity - call
C8WB-14406-BR	XR7 to standard fuel sender adapter harness	1967-70 XR7 adapter harness for use with 1-post fuel sender	\$30.45	Limited Quantity
C9WY-14462-AR	Pigtail, low-fuel, red with blue-overmold 5/16" ring	1969-70 XR7 with low fuel	10.50	NEW!
C7AB-14488-RB	Starter solenoid rt angle pigtails, pr.	1967-70 Cougar	\$12.10	
C9WB-14489	Connector shell, instrument cluster	1969-70 Cougar	\$10.50	
C9SZ-15A217-AR	Cornering Light Adapter kit	1969 Thunderbird	\$105.00	NEW!
C1SZ-15A217-AR	Cornering Light Adapter kit	1970-71 Thunderbird	\$105.00	NEW!
D0WY-15A434-LSM	Side marker LED Adapter kit	1970 Cougar – front and rear (four 194 style bulbs) Required to use front WCCC1157Y LED lights.	\$173.20	
D1WY-15A434-LSM	Side marker LED Adapter kit	1971 Cougar – rear only (two 194 style bulbs) Required to use front WCCC1157Y LED lights. Rear side marker LED bulbs are included.	\$86.65	



Part Number	Description	Vehicle Application	MSRP	Notes
C8WB-15A442-APR	Front Marker light harnesses, pr.	1968 Cougar	\$92.95	Now with retaining rings.
C7ZB-19A885-BR	A/C thermostat to clutch harness	1967-68 Mustang/Cougar	\$13.60	Limited Quantity
C9ZB-19A985-BR	A/C thermostat to clutch harness	1969-70 Mustang Cougar	\$13.60	Limited Quantity
C7ZB-19945-A	A/C under dash harness	1967-68 Mustang/Cougar	\$51.95	Limited Quantity
C8ZZ-AMFM-A	Radio wire pigtails, pr. 2-pin, 3-pin 12"	1968-70 Mustang/Cougar/Ford Mercury, radio side	\$21.75	
C8ZZ-AMFM-B	Radio wire pigtail mates, pr. 2-pin, 3-pin 12"	1968-70 Mustang/Cougar/Ford Mercury, Speaker harness side	\$21.75	
C8ZZ-AM-A	Radio wire power pigtail, 2-pin 12"	1968-70 Mustang/Cougar/Ford/Mercury", Radio side	\$10.90	
C8ZZ-AM-B	Radio power pigtail mate, pr. 2-pin 12"	1968-70 Mustang/Cougar/Ford/Mercury. , 14401 harness side	\$10.90	
C8ZZ-AMFM-C	Speaker harness pigtails, 3-pin 12"	1968-70 Mustang/Cougar/Ford/Mercury, Radio side	\$10.90	
C8ZZ-AMFM-D	Speaker wire pigtail mates, 3-pin 12"	1968-70 Mustang/Cougar/Ford/Mercury, Speaker harness side	\$10.90	
	Turn Signal Switches & parts	Use switches with LED bulbs only or with Switch Saver™ for incandescent bulb use		
C7SZ-13341-ER	Turn signal Switch Kit	1967 Thunderbird w/Tilt column w/o cruise	\$288.75	
C7SZ-13L341-ER	Turn signal Switch Saver™ Kit	1967 Thunderbird w/Tilt column Switch Saver™	\$125.95	NEW!
C7SZ-13341-FR	Turn signal Switch Kit	1967 Thunderbird w/Tilt column w/cruise Note: cruise switches disabled.	\$288.75	
C7SZ-13L341-FR	Turn signal Switch Saver™ Kit	1967 Thunderbird w/Tilt column and cruise Switch Saver™	\$125.95	NEW!
C7ZZ-13341-ER	Turn signal Switch	1967 Cougar/Mustang w/Tilt column - includes correct pins!	\$141.75	
C7ZZ-13341-FR	Turn signal Switch	1967 Cougar/Mustang w/o Tilt column - includes correct pins!	\$110.25	
C7WY-13L341-BR	Turn signal Switch Saver™ Kit	1967 Cougar Switch Saver™	\$136.45	NEW!
C8SZ-13341-AR	Turn signal Switch	1968 Cougar/Mustang/Thunderbird w/o Tilt column, service part	\$110.25	
C8SZ-13341-BR	Turn signal Switch	1968-69 Cougar/Mustang, 1968 Thunderbird w/Tilt column, srvc part	\$141.75	
C8SZ-13L341-BR	Turn signal Switch Saver™ Kit	1968 Thunderbird w/o cruise Switch Saver™	\$125.95	NEW!



Part Number	Description	Vehicle Application	MSRP	Notes
C8SZ-13341-CR	Turn signal Switch	1968 Thunderbird w/Tilt column, w/cruise Note: Cruise switches disabled.	\$183.75	
C8SZ-13L341-CR	Turn signal Switch Saver™ Kit	1968 Thunderbird w/cruise Switch Saver™	\$125.95	NEW!
C8ZZ-13341-BR	Turn signal Switch	1968-69 Cougar/Mustang only, w/Tilt column	\$152.25	
C8WY-13L341-BR	Turn signal Switch Saver™ Kit	1968 Cougar Switch Saver™	\$136.45	NEW!
C9AZ-13341-BR	Turn signal Switch	1969 Cougar/Mustang w/o Tilt column	\$110.25	
C9WY-13L341-BR	Turn signal Switch Saver™ Kit	1969-72 Cougar Switch Saver™	\$136.45	NEW!
C9SZ-13341-AR	Turn signal Switch Kit	1969 Thunderbird/Mark III w/o Tilt column, w/o cruise with cornering light option	\$288.75	
C9SZ-13341-BR	Turn signal Switch Kit	1969 Thunderbird/Mark III w/Tilt column, w/o cruise, with cornering light option	\$288.75	
C9SZ-13L341-BR	Turn signal Switch Saver™ Kit	1969 -72 w/o cruise Thunderbird Switch Saver™	\$136.45	NEW!
C9SZ-13341-CR	Turn signal Switch	1969 Thunderbird w/Tilt column, w/cruise Note: Cruise switches disabled.	\$288.75	
D1SZ-13341-AR	Turn signal Switch	1970-71 Thunderbird w/o Tilt column	\$288.75	
D1SZ-13341-BR	Turn signal Switch	1970-71 Thunderbird w/Tilt column	\$288.75	
D2AZ-13341-CR	Turn signal Switch	1970-72 Cougar/Mustang w/o Tilt column Note: for use with LED bulbs only!	\$126.00	
D2AZ-13341-DR	Turn signal Switch	1970-72 Cougar/Mustang w/Tilt column - includes correct pins!	\$131.25	
D3AZ-13341-CR	Turn signal Switch	1973 Cougar/Mustang w/o Tilt column	\$105.00	
D3AZ-13341-DR	Turn signal Switch	1973 Cougar/Mustang w/Tilt column	\$131.25	
C4AZ-14461-AR	Pin, male, turn signal switch, Pkg of 10	1967-72 Ford	\$5.25	
C4AZ-14488-BR	Pin, female, turn signal switch, Pkg of 10	1967-72 Ford	\$5.25	
C5SZ-14489-A	Connector shell, 10-pin rectangular, white, turn signal harness side	1967 Cougar, Ford, Thunderbird	\$10.50	New!
C5SZ-14489-B	Connector shell, 10-pin rectangular, white, turn signal switch side	1967 Cougar, Ford, Thunderbird	\$10.50	New!
C8AZ-14489-S	Connector shell, 10-pin half-moon, black, turn signal switch side	1967-72 Ford	\$10.50	New!
C8AZ-14489-AA	Connector shell, 10-pin half-moon, black, harness side	1967-72 Ford	\$10.50	New!



Part Number	Description	Vehicle Application	MSRP	Notes
C4AZ-17018-X	Turn signal switch connector female pin extractor	1967-72 Ford	\$31.50	
C7WY-11654-AR	Headlight switch	1967 Cougar without vacuum control	\$36.75	
C8WY-11654-AR	Headlight switch	1968-70 with vacuum control	\$47.25	Made in U.S.A.
C8MY-1424-AR	Spare tire hold down plate	1968-69 Cougar/Mustang with styled steel wheel	\$26.20	Limited Quantity
C9WY-14A018-LR	Adapter, 1969-70 door ajar switch mount, left and right pr.	1969-70 Cougar/Mustang	\$5.25	NEW!
C7SZ-14526-AR	Rear tail light circuit breaker, 5A 12V	1967-68 Cougar	\$15.00	New!
C9AZ-14526-ER	16ga black fusible link with black-overmold 5/16" ring	1969-72 Cougar/Mustang/Ford	\$10.50	NEW!
C5AZ-14677-AR	Window motor relay kit, 1 ea.	1969-73 Cougar, 1965-1973 Ford	\$62.95	NEW!
C5AZ-14677-AK	Window motor relay kit, 4 ea.	1969-73 Cougar, 1965-1973 Ford	\$335.95	NEW!
D0WY-17713-INS	RH Mirror base installation kit	1969-70 Cougar	\$15.00	Limited Quantity
CU1157R	LED bulb, Red tail lights, pr.	1967-73 Cougar, 1967-70 Shelby, 1965-1971 T-Bird		Discontinued
CU1157Y	LED bulb, Amber tail lights, pr.	1967-73 Cougar, 1967-70 Shelby, 1965-1971 T-Bird		Discontinued
TT-100	Tachometer Tester	Ford, GM, Aftermarket Tachs	\$629.95	Special Order
WCCC1157R	"Plasma" LED bulb, Red tail lights, pr.	1967-73 Cougar, 1967-70 Shelby, 1965-1971 T-Bird	\$35.70	Back in stock!
WCCC1157Y	"Plasma" LED bulb kit, Yellow front, pr.	1967-73 Cougar, 1967-70 Shelby, 1965-1971 T-Bird. Note: Must be purchased with Side Marker LED Adapter Kit when used on 1970 & up cars with alternating flashing side marker lights.	\$35.70	Back in stock!



Cougars Unlimited LLC Sales and Return Policy

1. All sales are final. Cougars Unlimited LLC sells fully tested, proven solutions for sequential turn signal systems. We offer troubleshooting advice based on over 35 years of experience and have published several excellent troubleshooting guides (see our web site at **www.cougarsunlimited.net**). Due the difficulty of diagnosing electrical problems in 50 year old cars over the phone or email, we cannot guarantee that any suggested solution will solve your particular problem.
2. No cash refunds will be issued. Credit may be issued for items shipped due to a clerical error if *all* materials are returned postpaid in resalable condition. A restocking fee of 20% will be imposed to cover retesting, replacing missing components, and reboxing returns. No credit will be issued for damaged or previously installed items - they may be repaired and returned only.
3. Warranty: Cougars Unlimited LLC manufactured parts are covered under a limited warranty for two years after purchase. Should a fail occur during this warranty period, it will be repaired or replaced upon prepaid return Cougars Unlimited LLC. This limited warranty does not include repair of damage resulting from accident, disaster, misuse, abuse, unauthorized modifications or any use beyond normal operating conditions. This warranty excludes any coverage for incidental or consequential damages.
4. Warranty claims: Parts covered under warranty must be returned postpaid. Parts determined to be defective will be repaired or replaced with an equivalent part. Parts determined to be functional within the manufacturer's specifications will be returned upon payment of a minimum testing and return shipment fee of \$25.00. Foreign return shipping is not included and must be prepaid.